New Hampshire Volunteer Lake Assessment Program

2002 Bi-Annual Report for Baxter Lake Farmington



NHDES Water Division Watershed Management Bureau 6 Hazen Drive Concord, NH 03301



Observations & Recommendations

After reviewing data collected from **BAXTER LAKE**, the program coordinators recommend the following actions.

FIGURE INTERPRETATION

Figure 1 and Table 1: The graphs in Figure 1 (Appendix A) show the historical and current year chlorophyll-a concentration in the water column. Table 1 (Appendix B) lists the maximum, minimum, and mean concentration for each sampling season that the lake/pond has been monitored through the program.

Chlorophyll-a, a pigment naturally found in plants, is an indicator of the algal abundance. Because algae are usually microscopic plants that contain chlorophyll-a and are naturally found in lake ecosystems, the chlorophyll-a concentration found in the water gives an estimation of the concentration of algae or lake productivity. The mean (average) summer chlorophyll-a concentration for New Hamsphire's lakes and ponds is 7.02 ug/L.

Similar to the summer of 2001, the summer of 2002 was filled with many warm and sunny days and there was a lower than normal amount of rainfall during the latter-half of the summer. The combination of these factors resulted in relatively warm surface waters throughout the state. The lack of fresh water to the lakes/ponds reduced the rate of flushing which may have resulted in water stagnation. Due to these conditions, many lakes and ponds experienced increased algae growth, including filamentous green algae (the billowy clouds of green algae typically seen floating near shore), and some lakes/ponds experienced nuisance cyanobacteria (blue-green algae) blooms.

The current year data (the top graph) show that the chlorophyll-a concentration *increased* from June to July. Unfortunately, due to a laboratory equipment malfunction, the chlorophyll data for the August sampling event was not available. We apologize for this problem and loss of data.

The historical data (the bottom graph) show that the 2002 chlorophyll-a mean is *less than* the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows *a relatively stable* in-lake chlorophyll-a trend. Specifically, the chlorophyll-a concentration has remained *approximately the same*, and has been *less than* the state mean, since monitoring began. Unfortunately, the historic data could not be statistically analyzed this season since the lake was not sampled in 1996. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historic data to objectively determine if there has been a significant change in the annual mean chlorophyll-a concentration.

While algae is naturally present in all lakes/ponds, an excessive or increasing amount of any type is not welcomed. In freshwater lakes/ponds, phosphorus is the nutrient that algae depend upon for growth. Therefore, algal concentrations may increase when there is an increase in nonpoint sources of nutrient loading from the watershed, or in-lake sources of phosphorus loading (such as phosphorus releases from the sediments). It is important to continually educate residents about how activities within the watershed can affect phosphorus loading and lake quality.

Figure 2 and Table 3: The graphs in Figure 2 (Appendix A) show historical and current year data for lake/pond transparency. Table 3 lists the maximum, minimum and mean transparency data for each sampling season that the lake/pond has been monitored through the program.

Volunteer monitors use the Secchi-disk, a 20 cm disk with alternating black and white quadrants, to measure water clarity (how far a person can see into the water). Transparency, a measure of water clarity, can be affected by the amount of algae and sediment from erosion, as well as the natural colors of the water. The mean (average) summer transparency for New Hampshire's lakes and ponds is 3.7 meters.

Two different weather related patterns occurred this past spring and summer that influenced lake quality during the summer season.

In late May and early June of 2002, numerous rainstorms occurred. Stormwater runoff associated with these rainstorms may have increased phosphorus loading, and the amount of soil particles washed into waterbodies throughout the state. Some lakes and ponds experienced lower than typical transparency readings during late May and early June.

However, similar to the 2001 sampling season, the lower than average amount of rainfall and the warmer temperatures during the latter-half of the summer resulted in a few lakes/ponds reporting their best-ever

Secchi-disk readings in July and August (a time when we often observe reduced clarity due to increased algal growth)!

The current year data (the top graph) show that the in-lake transparency **remained stable** from June to July, and then **increased slightly** from July to August. On the July sampling event the secchi disk was visible on the bottom, which indicated that the water level was lower in July than in August.

The historical data (the bottom graph) show that the 2002 mean transparency is *slightly less than* the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows **a stable** trend for in-lake transparency. Specifically, this means that the transparency has **remained stable**, **and approximately one meter less than** the state mean, since monitoring began.

Unfortunately, the historic data could not be statistically analyzed this season since the lake was not sampled in 1996. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historic data to objectively determine if there has been a significant change in the annual mean transparency.

Typically, high intensity rainfall causes erosion of sediments into lakes/ponds and streams, thus decreasing clarity. Efforts should continually be made to stabilize stream banks, lake/pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the lake/pond. Guides to Best Management Practices designed to reduce, and possibly even eliminate, nonpoint source pollutants, such as sediment loading, are available from NHDES upon request.

Figure 3 and Table 8: The graphs in Figure 3 (Appendix A) show the amounts of phosphorus in the epilimnion (the upper layer) and the hypolimnion (the lower layer); the inset graphs show current year data. Table 8 (Appendix B) lists the annual maximum, minimum, and median concentration for each deep spot layer and each tributary since the lake/pond has joined the program.

Phosphorus is the limiting nutrient for plant and algae growth in New Hampshire's freshwater lakes and ponds. Too much phosphorus in a lake/pond can lead to increases in plant and algal growth over time. The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 11 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.

The current year data for the epilimnion (the top inset graph) show that the total phosphorus concentration **decreased slightly** from June to July, and then **remained stable** from July to August.

The historical data show that the 2002 mean epiliminetic total phosphorus concentration was **slightly less than** the state mean.

The current year data for the hypolimnion (the bottom inset graph) show that the total phosphorus concentration **remained approximately stable** from June to July, and then **increased slightly** from July to August.

The historical data show that the 2002 mean hypolimnetic total phosphorus concentration was *less than* the state mean.

Overall, visual inspection of the historical data trend line for the epilimnion show **a variable** total phosphorus trend, which means that the concentration has **fluctuated** in the epilimnion since monitoring began.

Overall, visual inspection of the historical data trend line for the hypolimnion shows **a** stable total phosphorus trend. Specifically, this means that the concentration in the hypolimnion has **remained** approximately the same, and has been slightly less than the state median, since monitoring began. We hope this trend continues!

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about its sources and how excessive amounts can adversely impact the ecology and value of lakes and ponds. Phosphorus sources within a lake or pond's watershed typically include septic systems, animal waste, lawn fertilizer, road and construction erosion, and natural wetlands. If you would like to educate watershed residents about how they can help to reduce phosphorus loading into the lake/pond, please contact the VLAP Coordinator.

TABLE INTERPRETATION

> Table 2: Phytoplankton

Table 2 lists the current and historic phytoplankton species observed in the lake/pond. The dominant phytoplankton species observed in the July sample this year was **Anabaena** (a cyanobacteria).

On June 24th the volunteer monitors reported that an algae bloom was occurring in the lake. The volunteer monitors brought a sample of the bloom to the DES lab and it was identified as *Microcystis* (a cyanobacteria).

Anabaena and Microcystis can be toxic to livestock, wildlife, pets, and humans if a large "surface bloom" occurs. Cyanobacteria can reach nuisance levels when excessive nutrients and favorable environmental conditions occur. As with the summer of 2001, we observed that some lakes and ponds had cyanobacteria present during the 2002 summer season, likely due to the many warm and sunny days that occurred this summer, which may have accelerated algal and bacterial growth. In addition, the lower than normal amount of rainfall during the latter half of the summer, meant that the slow flushing rates resulted in less phosphorus exiting the lake outlet and more phosphorus being available for plankton growth.

The presence of cyanobacteria serves as a reminder of the lake's/pond's delicate balance. Watershed residents should continue to act proactively to reduce nutrient loading into the lake/pond by eliminating fertilizer use on lawns, keeping the lake/pond shoreline natural, re-vegetating cleared areas within the watershed, and properly maintaining septic systems and roads.

In addition, residents should also observe the lake/pond in September and October during the time of fall turnover (lake mixing) to document any algal blooms that may occur. Cyanobacteria (bluegreen algae) have the ability to regulate their depth in the water column by producing or releasing gas from vesicles. However, occasionally lake mixing can affect their buoyancy and cause them to rise to the surface and bloom. Wind and currents tend to "pile" cyanobacteria into scums that accumulate in one section of the lake/pond. If a fall bloom occurs, please contact the VLAP Coordinator.

> Table 4: pH

Table 4 (Appendix B) presents the in-lake and tributary current year and historical pH data.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 5.5 severely limits the growth and reproduction of fish. A pH between 6.5 and 7.0 is ideal for fish. The mean pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is 6.5, which indicates that the surface waters in state are slightly acidic. For a more detailed explanation regarding pH, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

The mean pH in the **epilimnion** this season was **6.3**, which means that the water is **slightly acidic**.

Due to the presence of granite bedrock in the state and the deposition of acid rain, there is not much that can be done to effectively increase lake/pond pH.

> Table 5: Acid Neutralizing Capacity

Table 5 in Appendix B presents the current year and historic epilimnetic ANC for each year the lake/pond has been monitored through VLAP.

Buffering capacity or ANC describes the ability of a solution to resist changes in pH by neutralizing the acidic input to the lake. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

The Acid Neutralizing Capacity (ANC) of the **epilimnion** (the upper layer) continues to remain **low** (2.07 mg/L as CaCO₃) and is **well below** the state mean of 6.7 mg/L (Table 5). Specifically, this means that the lake/pond is "**extremely vulnerable**" to acidic inputs (such as acid precipitation) and has a **lower** ability than many lakes and ponds in the state to buffer against acidic inputs.

> Table 6: Conductivity

Table 6 in Appendix B presents the current and historic conductivity values for tributaries and in-lake data. Conductivity is the numerical expression of the ability of water to carry an electric current. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

The conductivity has **increased** in the lake/pond and inlets since monitoring began (Table 6). Typically, sources of increased conductivity are due to human activity. These activities include septic systems that fail and leak leachate into the groundwater (and eventually into the tributaries and the lake/pond), agricultural runoff, and road runoff (which contains road salt during the spring snow melt). New development in the watershed can alter runoff patterns and expose new soil and bedrock areas, which could contribute to increasing conductivity. In addition, natural sources, such as iron deposits in bedrock, can influence conductivity. It is possible that the lower than normal amount rainfall during the latter-half of the summer reduced tributary and lake flushing, which allowed pollutants and ions to build up and resulted in elevated conductivity We recommend that your monitoring group conduct stormwater sampling along the inlets with elevated conductivity so that we can determine what may be causing the increases. For a detailed explanation on how to conduct stormwater sampling, please refer to this year's "Special Topic Article" which is included in Appendix D of this report.

> Table 8: Total Phosphorus

Table 8 in Appendix B presents the current year and historic total phosphorus data for in-lake and tributary stations. Phosphorus is the nutrient that limits the algae's ability to grow and reproduce. Please refer to page 17 of the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

Table 9 and Table 10: Dissolved Oxygen and Temperature Data

Table 9 in Appendix B shows the dissolved oxygen/temperature profile(s) for the 2002 sampling season. Table 10 shows the historical and current year dissolved oxygen concentration in the hypolimnion (lower layer). The presence of dissolved oxygen is vital to fish and amphibians in the water column and also to bottom-dwelling organisms. Please refer to the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

Dissolved oxygen was **high** at all depths sampled at the deep spot of the lake/pond. Typically, shallow lakes and ponds that are not deep enough to stratify into more than one or two layers will have relatively high amounts of oxygen at all depths. This is due to continual lake mixing and diffusion of oxygen into the bottom waters induced by wind and wave action.

> Table 11: Turbidity

Table 11 in Appendix B lists the current year and historic data for inlake and tributary turbidity. Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to page 19 of the "Other Monitoring Parameters" section of this report for a more detailed explanation.

The turbidity in the **Dineen Brook** sample was slightly elevated on the **July** sampling event, which suggests that the stream bottom may have been disturbed while sampling. When the stream bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting samples in the inlets, please be sure to sample where there the stream is flowing and where the stream is deep enough to collect a "clean" sample.

> Table 12: Bacteria (E.coli)

Table 12 lists the current year data for bacteria (E.coli) testing. E. coli is a normal bacterium found in the large intestines in humans and other warm-blooded animals. E.coli is used as an indicator organism because it is easily cultured, and its presence in the water, in defined amounts, indicates that sewage **MAY** be present. If sewage is present

in the water, potentially harmful pathogens may also be present. Please consult page 20 of the "Other Monitoring Parameters section of the report for the current standards for *E. coli* in surface waters. If residents are concerned about sources of *E.coli* such as septic system impacts, animal waste, or waterfowl waste, it is best to conduct *E. coli* testing when the water table is high or after rain events.

The *E. coli* result at the **Beach Recreation Area** was very low on the **August** sampling event. Specifically, the result was **3** counts/100 ml, which is **well below** the state standard of 88 counts per 100 mL for designated public beaches.

The *E. coli* concentration at the *Campground Beach* was slightly elevated on the **June and July** sampling events. However, the concentration *was not greater than* the state standard of 88 counts per 100 mL designated for public beaches on either date.

If you are concerned about *E. coli* levels at this beach, you may want to repeat this test on a weekend during heavy beach use or after a rain event. Since bacteria die quickly in cool pond waters, testing is most accurate and most representative of the health risk to bathers when the source (humans, animals, or waterfowl) is present.

DATA QUALITY ASSURANCE AND CONTROL

Annual Assessment Audit:

During the annual visit to your lake/pond, the biologist conducted a "Sampling Procedures Assessment Audit" for your monitoring group. Specifically, the biologist observed the performance of your monitoring group while sampling and filled out an assessment audit sheet to document the ability of the volunteer monitors to follow the proper field sampling procedures (as outlined in the VLAP Monitor's Field Manual). This assessment is used to identify any aspects of sample collection in which volunteer monitors are not following the proper procedures, and also provides an opportunity for the biologist to retrain the volunteer monitors as necessary. This will ultimately ensure that the samples that the volunteer monitors collect are truly representative of actual lake and tributary conditions.

Overall, your monitoring group did an **excellent** job collecting samples on the annual biologist visit this season! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the biologist to provide additional training. Keep up the good work!

Sample Receipt Checklist:

Each time your monitoring group dropped off samples at the laboratory this summer, the laboratory staff completed a sample receipt checklist to assess and document if the volunteer monitors followed proper sampling techniques when collecting the samples. The purpose of the sample receipt checklist is to minimize, and hopefully eliminate, future reoccurrences of improper sampling techniques.

Overall, the sample receipt checklist showed that your monitoring group did an *excellent* job when collecting samples and submitting them to the laboratory this season! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the laboratory staff to contact your group with questions, and no samples were rejected for analysis.

NOTES

- ➤ Monitor's Note (6/24/02): Tributary Flow in Cruze Brook was fast. Recent storms and heavy rain on 6/23 6/24. Algal bloom reported to DES on 6/24.
- \blacktriangleright Monitor's Note (7/19/02): Cruze Brook had no flow.
- ➤ Monitor's Note (8/12/02): Cruze Brook and Dineen had no flow. Drought! E. coli test taken at Baxter Lake Rec. Campground.

USEFUL RESOURCES

Changes to the Comprehensive Shoreland Protection Act: 2001 Legislative Session, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/sp/sp-8.htm

Cyanobacteria in New Hampshire Waters Potential Dangers of Blue-Green Algae Blooms, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/wmb/wmb-10.htm

The Lake Pocket Book. Prepared by The Terrene Institute, 2000. (internet: www.terrene.org, phone 800-726-4853)

Managing Lakes and Reservoirs, Third Edition, 2001. Prepared by the North American Lake Management Society (NALMS) and the Terrene Institute in cooperation with the U.S. Environmental Protection Agency. Copies are available from NALMS (internet: www.nalms.org, phone 608-233-2836), and the Terrene Institute (internet: www.terrene.org, phone 800-726-4853)

Organizing Lake Users: A Practical Guide. Written by Gretchen Flock, Judith Taggart, and Harvey Olem. Copies are available form the Terrene Institute (internet: www.terrene.org, phone 800-726-4853)

Proper Lawn Care in the Protected Shoreland: The Comprehensive Shoreland Protection Act, WD-SP-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-2.htm

Sand Dumping - Beach Construction, WD-BB-15, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-15.htm

Swimmers Itch, WD-BB-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-2.htm

Use of Lakes or Streams for Domestic Water Supply, WD-WSEB-1-11, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/ws/ws-1-11.htm


Water Milfoil, WD-BB-1, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-1.htm


Weed Watchers: An Association to Halt the Spread of Exotic Aquatic Plants, WD-BB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-4.htm

Appendix A: Graphs


Baxter Lake, Farmington


Figure 1. Monthly and Historical Chlorophyll-a Results

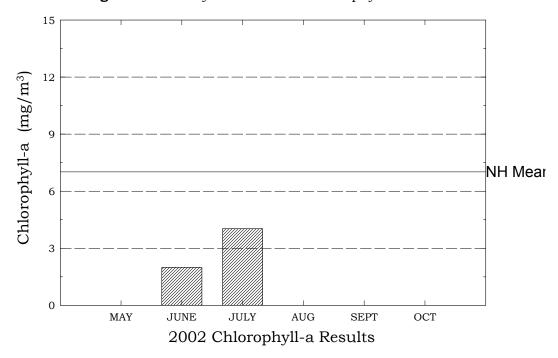

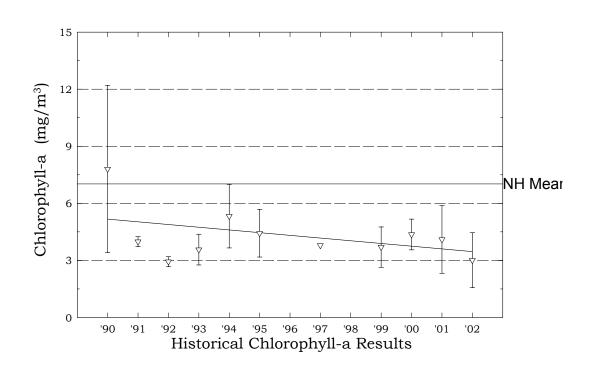

Baxter Lake, Farmington

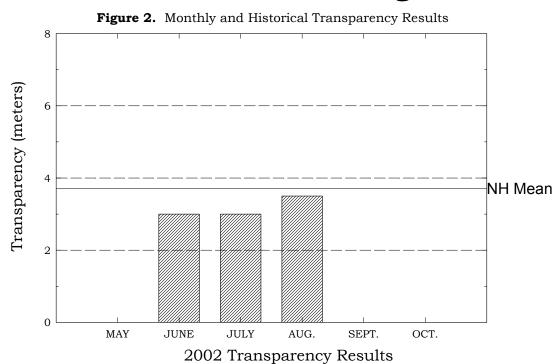

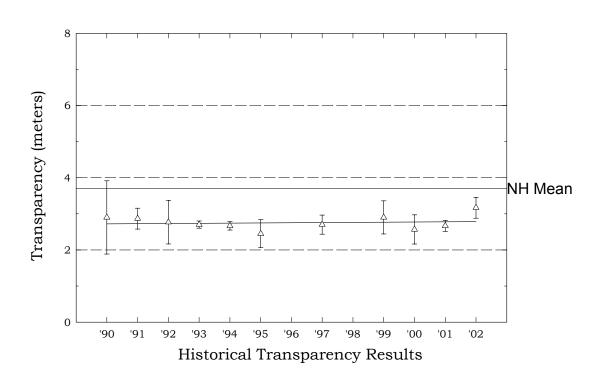

Baxter Lake, Farmington

